

Printronic Technical Bulletin	Number L-0109	Revision A
	Product Type L7032	Date 10/08
Subject Correction to LSU Failure troubleshooting procedures called out in the L7032 Maintenance Manual	Originator Tony Truong	Page 1 of 1

SUBJECT

Maintenance Manual for L7032 Continuous Form Laser Printer contains incorrect the LSU Failure troubleshooting procedure

INFORMATION

On page 117 of L7032 Laser Printer Maintenance Manual, part number 251827-001A

Current

Message Text	Explanation	Corrective Action
LSU Failure PLEASE CALL SERVICE	The LSU unit has failed	Replace the LSU

Replace by

Message Text	Explanation	Corrective Action
LSU Failure PLEASE CALL SERVICE	A false beam detect signal on the video line. The likely cause is short or arcing in the Main Charger. There is a small possibility that the LSU has actually failed.	Replace main charger. If problem persists, replace the LSU.